



Farécla Shrimper Process for Hull with Light Weathering Instructions



Materials Required

Profile 300 Rapid Cut & Surface Restorer
Profile UV Wax
Profile Polymer Wax
Double Sided Wool Pad
Farécla Industrial Polishing Machine

Farécla Prep Wipes* (discont)
Farécla Finishing Cloth
14mm D/S Adapter
Spurring Brush

Step 1: Degrease the Hull

Degrease the hull using Prep Wipes (*or an alcohol based glass cleaner) to remove any waxes and contaminates from the surface. This is an essential part of the cleaning process.

Step 2: Profile 300 Compound

Put a small amount of compound onto the wool pad and spread compound over a small area of the topsides. Start the polishing machine on its slowest speed and, keeping the machine moving from side to side, increase speed gradually to about level 4. Continue until all discolouration has been removed and the surface has become shiny. In warm weather it may be necessary to keep the surface damp using a water spray bottle.

Note: At the end of this step all compound residue must be removed using a Farécla Finishing Cloth.

Step 3: Profile UV Wax

Using a soft cloth spread a small amount of Profile UV Wax on to the surface of the hull. Leave for around 30 seconds to haze then remove using a Farécla Finishing Cloth. A second coat of Profile UV Wax may be applied for enhanced protection.

Step 4: Profile Polymer Wax

Using a soft cloth spread a small amount of Profile Polymer Wax on to the surface of the hull. Leave for around 30 seconds to haze then remove using a Farécla Finishing Cloth.